IB086050

inductive sensors (high temperature)



Inductive proximity switches are contact-free sensors. They detect all conductive metals, regardless of whether they move or not. The achievable sensing range of the devices depends on the object material and its dimensions. The vibration-resistant sensors can be approached laterally or frontally. Inductive proximity switches are used for presence detection (e.g. goods carriers), positioning (e.g. dampers), counting (e.g. nuts /bolts), speed detection (e.g. for cog wheels), on conveyor systems (e.g. hose feedings) or distance measurements (e.g. press-in checking) of metallic objects.



TECHNICAL DATA

Devices for hose mounting	NO
Feeding technology	NO
Hygienic and wet area	NO
Metallic sensor surface	NO
Oil and lubriating coolants	NO
Ring-shaped sensors	NO
Rough ambient conditions	NO
Welding proof sensors	NO
Ambient temperature (min/max)	0°C / 140°C
Ambient temperatures > -25°C	NO
Cable length	3m
Compression-resistant	NO
Construction type housing	Cylinder, screw-thread
Degree of protection (IP)	IP50
High-pressure resistant sensors	NO
Increased ambient temperatures > 80°C	YES
Length of sensor	30mm
Material active area of sensor	Vectra®
Material housing	Stainless steel V2A
Material housing	Metal
Material independent sensors (factor 1)	NO
Material of cable sheath	PTFE
Mechanical mounting condition for sensor	Concise
Pitch thread	1mm
Sensors uneffected by atmospheric changes (temperature cycle)	NO
Teflon housing	NO
Thread length	23mm
Thread size metric (M)	8
Cascadable	NO
Connection to an amplifier	YES
Distance measuring sensors	NO

Tel +49 2351 9365-0 Fax +49 2351 9365-19

IB086050


inductive sensors (high temperature)



TECHNICAL DATA


Double sensing range	NO
Hysteresis	15%
Increased sensing range	NO
Norm trimming plate	8x8x1
Quadruple sensing range	NO
Reverse polarity protection	YES
Short-circuit-proof	NO
Suited for safety functions	NO
Switching distance	2mm
Switching frequency	300Hz
Triple sensing range	NO
Type of electric connection	Connector M12
Type of switch function	Amplifier
Type of switching output	Amplifier
Voltage type	DC
With LED indication	NO
With monitoring function downstream switching devices	NO
Areas inquiry	NO
End position inquiry hydraulic cylinder	NO
Welding areas	NO

CONNECTION



Colors: 1 = BN (brown), 2 = WH (white), 3 = BU (blue), 4 = BK (black) **Functions:** 1 = L+, 2 = n. c., 3 = L-, 4 = n. c.

DIMENSIONAL DRAWING

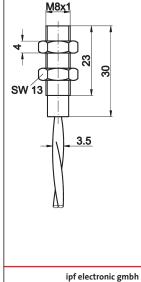

IB086050



inductive sensors (high temperature)

ADDITIONAL INFORMATION